
## All models

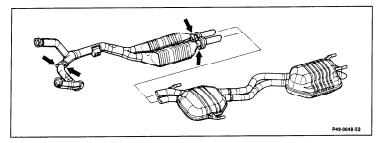

Shown on model 140.042/051

Retighten bolts on slip joints or flanged connections. Torque to 20 Nm.

## Note:

When performing this job number, the engine compartment lower panel or the noise encapsulation panel must be removed, and replaced after completing all maintenance work (refer to Job No. 6190 or 9490).